

View Measure M

Measure no. 52288206-02	Subject Optimisation of the CAS software at the customer's request	
Release date (dd/mm/yy) 06/11/12	Status Approved	Organization GB, CAR

Vehicles affected

E series E60 E61 E63 E64 E70 E71 E81 E82 E84 E87 E88 E89 E90 E91 E92 E93	Engine	Body
Production period (from/to) (dd/mm/yy) 01/03/07 / 31/08/11	Comment on production period	Feedback (all cases relating to measure up to) (dd/mm/yy)

Complaint

The customer is requesting that the vehicle security is updated.

Note:

In the course of simplifying the software, the "Comfort opening using ignition key in the door lock" function, which is rarely or never used by the customer, has been removed. The "Comfort opening using the remote control in the ignition key" function, remains in place.

Cause

Software in the Car Access System control unit (CAS)

Measure

In the event of complaint program the vehicle as follows using ISTA/P 2.48.1 or a more recent version.

- Connect the battery charger to the vehicle.
- Connect the programming system to the vehicle.
- Select the "Vehicle" tab.
- Select the "Conversions" tab.
- Select "Modification, deactivate mechanical convenience opening via the driver's door lock".
- At "Confirmation prompt", select "OK".

Note:

The vehicle order element "OKOS" has been added to the measures plan and the CAS for programming/coding has been ordered. All other actions that are suggested by the system have been removed.

Do not take any further actions for this conversion.

- Accept / fully work through the measures plan with the control units to be programmed/coded and, where appropriate, enabled.
- Check the repair list.
- Depending on the repair list, if required, connect the workshop system to the vehicle, run a vehicle test and clear the fault code memory.

Note: