



## SUBJECT

### Enabling Codes (FSC) Required After CIC Replacement

## MODEL

E82, E88 \*(1 Series)

E90, E91, E92, E93 \*(3 Series)

\*with option 609 (Navigation System Professional)

Vehicles from September 2008 onward

## SITUATION

After replacing the Car Information Computer (CIC), the following functions are inoperative:

- Navigation System
- Voice Recognition System

## CAUSE

Enabling codes (FSC) are required to activate the navigation and voice recognition systems.

## PROCEDURE

**NOTE: If, during the course of diagnosis, a CIC needs to be replaced, the only part that should be installed is a new part that has not been previously installed in a vehicle. The CIC enabling codes are VIN-specific and if installed in another vehicle, the Navigation System and the Voice Recognition System (SVS) will not function. Do not swap parts from donor vehicles.**

- In the EPC (Electronic Parts Catalog), always order the three enabling codes together with a replacement CIC:
  - CIC Navigation Enabler Release Code (to activate Release Code functionality)
  - CIC Navigation Application Release Code (to activate the navigation function)
  - CIC Voice Repair Release Code (to activate voice control SA620)

These three enabling codes will be supplied via ASAP.

- Download the enabling codes on ASAP.

**NOTE: The enabling codes that are downloaded via ASAP are in a compressed file format. The file must be uncompressed, and the contents copied to the root directory (not in a folder) of a blank formatted floppy disk, on a USB or burned to a CD.**

- Load the Release Codes when prompted by Progman or ISTA/P.

## **WARRANTY INFORMATION**

For information only

[ Copyright © 2009 BMW of North America, LLC ]