# **Original BMW Accessories.** Installation Instructions.



Retrofit HiFi System Alpine BMW 1 Series (E81, E82, E87, E88) built after 3/09 BMW 3 Series (E90, E91, E92, E93) built after 3/09 BMW X1 (E84)

### Installation instructions not valid for vehicles with HiFi system

Retrofit kit No.:	65 41 2 163 268	Retrofit kit - HiFi System Alpine
	65 41 2 167 061	Retrofit kit - HiFi System Alpine

#### Installation time

The installation time is **approx. 2.0 hours**. The installation time increases by **0.25 hours** on vehicles with option SA 662 built after 9/09. The specified time may vary depending on the vehicle's condition and equipment.

The total costs for the programming time should be taken into account when calculating retrofitting costs (reimbursement through warranty is not permissible).

The installation time does not include the time required for programming/encoding which depends on the vehicle's age and equipment.

#### Important information

These installation instructions are primarily designed for use within the BMW dealership organisation and by authorised BMW service companies.

The target group of these installation instructions are technical personnel trained on BMW vehicles with corresponding technical know-how.

All work must be completed using the latest BMW repair manuals, circuit diagrams, servicing manuals and work instructions, in a rational order, using the specified tools (special tools) and observing current health and safety regulations.

# In the event of installation or functional problems, limit troubleshooting to 0.5 hours for mechanical jobs and 1.0 hours for electrical jobs.

To avoid unnecessary work and costs, send a corresponding enquiry via the Aftersales Assistance Portal (ASAP) using the technical parts support application.

Please quote the following:

- Vehicle identification number
- Part number of retrofit kit
- Exact description of the problem
- Work already carried out

Do not archive the hard copy of these installation instructions since daily updates are made by ASAP!

### Pictograms

Denotes information that draws attention to specific requirements.

• Denotes the end of an instruction text.

### **Customer information**

The "Customer Information on the HiFi System Alpine" at the end of the installation instructions should be printed out and handed over to the customer.

#### Installation information

Ensure that the cables/lines are not kinked or damaged as you install them in the car. Costs incurred as a result of incorrect installation will not be reimbursed by BMW AG.

Additional cables and/or lines that you install must be secured with cable ties.

If the specified PIN chambers are occupied, bridges, double crimps or twin-lead terminals must be used.

Only these installation instructions should be used for troubleshooting purposes. The information shown on the amplifier **C** does not correspond to the connection in the vehicle.

Vehicles equipped with option SA 662 do not require encoding.

#### **Ordering information**

The corner trim covers on the mirror triangle I, J or the covers on the window frame K, L are not included in the retrofit kit and must be ordered separately (see EPC for part number and details).

The connecting cable for central bass, right **M**, the central bass **N** and hexagon nuts **O** are additionally required for vehicles with option SA 662 built after 9/09. They are not included in the retrofit kit and must be ordered separately (see EPC for part number and details).

#### List of optional extras

The following optional extras must be taken into account when installing the retrofit kit:

- **SA 606** Navigation system Business
- **SA 609** Navigation system Professional
- SA 662 Radio BMW Business CD
- **SA 663** Radio BMW Professional

#### **Special tools required**


00 9 310, Mounting wedge 00 9 317, Panel wedge

# Contents

Section Page

1.	Parts overview
2.	Preparatory work
3.	Connections diagram
4.	Connections diagram, diplexer
5.	Installation and cabling diagram
6.	Installing and connecting retrofit kit
7.	Finishing off and coding
8.	Circuit diagram
9.	Customer information on HiFi System Alpine16

# 1. Parts overview

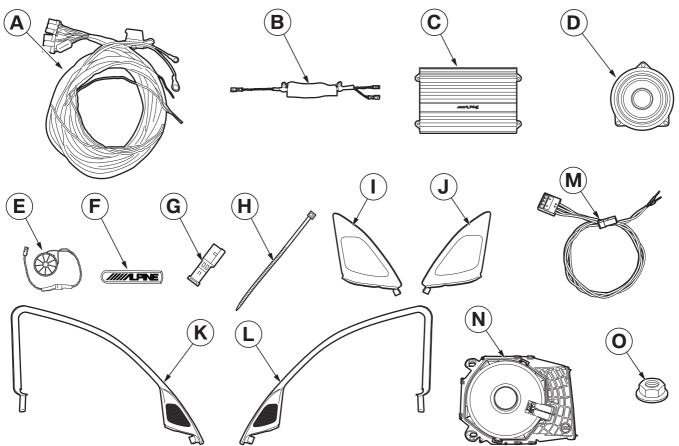

090 1510 Z


# Legend

- A Retrofit wiring loom
- B Diplexer (2x)
- **C** Amplifier
- D Mid-range speaker (2x)
- E Tweeter (2x)
- F Badge (2x)
- G 2-pin BL pin housing (only for vehicles with option SA 662 built after 9/09)
- H Cable tie (15x)
- Corner trim cover on mirror triangle, left (only for E82, E88, E92, E93 vehicles, not included in retrofit kit)
- J Corner trim cover on mirror triangle, right (only for E82, E88, E92, E93 vehicles, not included in retrofit kit)
- **K** Cover for window frame, left (only for E81, E87, E90, E91 vehicles, not included in retrofit kit)
- L Cover for window frame, right (only for E81, E87, E90, E91 vehicles, not included in retrofit kit)
- M Connecting cable for central bass, right (not included in retrofit kit, only for vehicles with option SA 662 built after 9/09)
- N Central bass, right (not included in retrofit kit, only for vehicles with option SA 662 built after 9/09)
- O Hexagon nut (2x, not included in retrofit kit, only for vehicles with option SA 662 built after 9/09)

# 2. Preparatory work

	ISTA No.
Perform quick test	
Disconnect negative terminal of battery	61 20 900
Remove the following components	
Sill cover panel, front (inner), left and right	51 47 000
Sill cover panel, rear (inner) left and right (only E87, E90, E91 vehicles)	51 47 030
Rear seat	52 26 005
Luggage compartment floor trim panel	51 47 101
Door trim panel, front left and right	51 41 000
Additionally for E81, E87, E90, E91, E92 vehicles	
Side section of rear seat backrest, left and right	52 26 008
Additionally for E81, E87, E90, E91 vehicles	
Cover on door window frame, inner left and right	51 32 160
Additionally for E82, E88, E92, E93 vehicles	
Inner trim cover on mirror triangle, left and right	51 16 000
Additionally for vehicles built after 3/09	
Loosen front seats	52 13 000
Remove central bass cover	65 12 050
Additionally for vehicles with option SA 662 built after 9/09	
Open door disconnector, right	
Door pillar trim panel, bottom right	51 43 150


# 3. Connections diagram

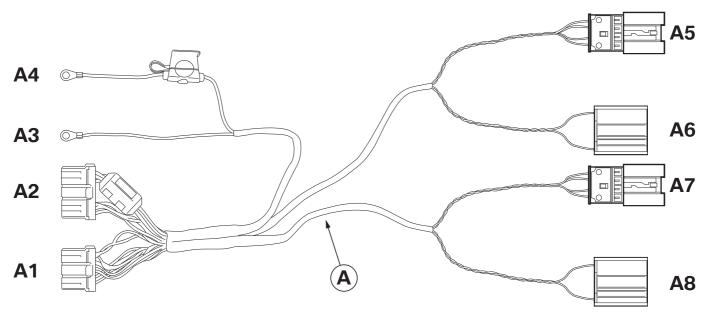

090 1507 Z

Branch/ Position	Designation	Signal	Cable colours/ cross section	Plug-in location in vehicle	Designation/ plug-in location
А	Retrofit wiring loom				
A1	10-pin WS socket housing			At amplifier <b>C</b>	
A2	14-pin WS socket housing			At amplifier <b>C</b>	
A3	Eyelet	Kl. 31	BR 4.0 mm <sup>2</sup>	At ground terminal on right in luggage compartment	X498
A4	Eyelet	KI. 30	RT 4.0 mm <sup>2</sup>	Only E81, E82, E87, E88, E84 vehicles At positive pin of battery terminal in luggage compartment well Only E90, E91, E92, E93 vehicles At positive pin of rear fuse box	 X10209
A5	4-pin SW pin housing			Only vehicles built before 9/09 or without option SA 662 built after 9/09 At vehicle-side connector of central bass, right Only vehicles with option SA 662 built after 9/09 At branch M1	X10373
A6	SW 4-pin socket housing			At central bass, right	X10373
A7	4-pin SW pin housing			At vehicle-side connector of central bass, left	X10372
A8	SW 4-pin socket housing			At central bass, left	X10372

# 4. Connections diagram, diplexer

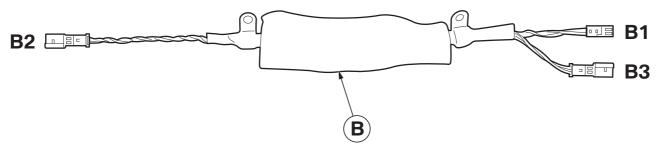

090 1508 Z

Branch/ Position	Designation	Signal	Cable colours/ cross section	Plug-in location in vehicle	Designation/ plug-in location
В	Diplexer				
B1	BL 2-pin socket housing			At mid-range speaker <b>D</b>	
B2	2-pin BL pin housing			At tweeter E	
B3	2-pin BL pin housing			At original socket housing to door speaker	


# Only vehicles with option SA 662 built after 9/09



084 0084 Z

Branch/ Position	Designation	Signal	Cable colours/ cross section	Plug-in location in vehicle	Designation/ plug-in location
М	Connecting cable for central bass, right				
M1	SW 4-pin socket housing			At branch <b>A5</b>	X10373
M2	BL 2-pin socket housing			At pin housing <b>G</b>	
M3	Pin contact	NF+	BL/BR 0.5 mm <sup>2</sup>	At door disconnector, right	X256 PIN 33
M4	Pin contact	NF-	BL/SW 0.5 mm <sup>2</sup>	At door disconnector, right	X256 PIN 34

# 5. Installation and cabling diagram

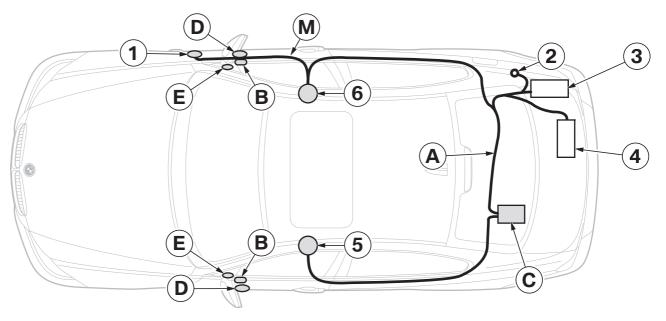



### Legend


- A Retrofit wiring loom
- **B** Diplexer
- **C** Amplifier
- D Mid-range speaker
- **E** Tweeter
- M Connecting cable for central bass, right (only vehicles with option SA 662 built after 9/09)
- 1 Door disconnector, right X256
- 2 Ground terminal point X498
- **3** Battery (only E90, E91, E92, E93 vehicles)
- 4 Battery (only E81, E82, E87, E88, E84 vehicles)
- 5 Central bass, left, connector **X10372**
- 6 Central bass, right, connector X10373


090 1514 Z

# 6. Installing and connecting retrofit kit

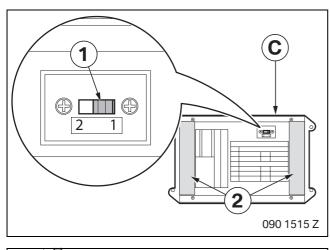


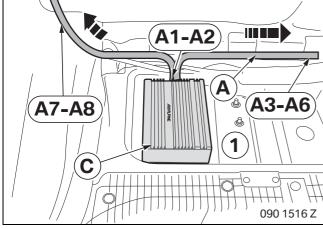

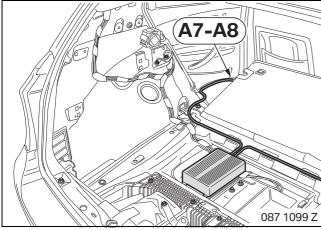

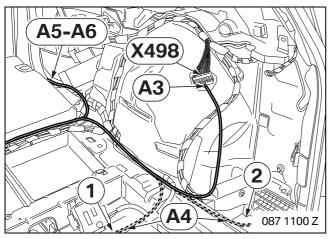

 Before installing amplifier **C** set switch (1) to position 1. Remove protective film from adhesive strips (2).



Adhere amplifier **C** in luggage compartment well (1).

Connect branches A1 and A2 to amplifier C.

Route branches **A3** and **A4** to the battery.

Route branches **A5** and **A6** to the right-hand side of the vehicle.

Run branches **A7** and **A8** to the left-hand side of the vehicle.



Install wiring harness as illustrated.

Route branches A7 and A8 under driver's seat.



Install wiring harness as illustrated. <

Route branches A5 and A6 under passenger's seat.


Route branch A3 to ground terminal X498.


**Only E81, E82, E87, E88, E84 vehicles** Route branch **A4** to positive pin of battery terminal (1).


Only E90, E91, E92, E93 vehicles


Route branch A4 to rear fuse box (2).

# 6. Installing and connecting retrofit kit

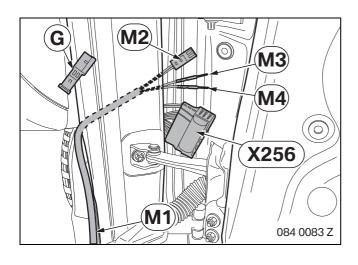

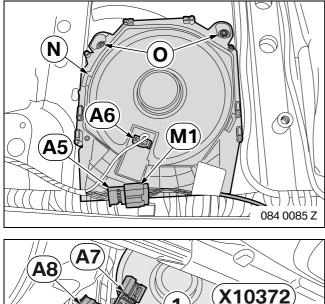

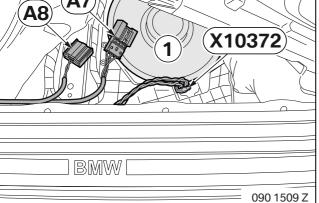

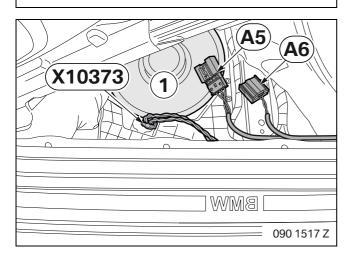

# Only vehicles with option SA 662 built after 9/09

Unplug lines from door disconnector **X256** and plug in at pin housing **G** as follows:

- BL/BR wire from PIN 33 at PIN 1
- BL/SW wire from PIN 34 at PIN 2

Plug in branches  $\ensuremath{\textbf{M3}}$  and  $\ensuremath{\textbf{M4}}$  at connector  $\ensuremath{\textbf{X256}}$  as follows:

- Branch M3, BL/BR wire, at PIN 33
- Branch M4, BL/SW wire, at PIN 34

Plug in branch  $\ensuremath{\textbf{M2}}$  at pin housing  $\ensuremath{\textbf{G}}.$ 

Route branch  $\ensuremath{\textbf{M1}}$  under passenger's seat.

Install central bass **N** with hexagon nuts **O** as described in ISTA No. 65 12 050.

Connect branch **M1** to branch **A5**.

Connect branch A6 to central bass N.


# Only vehicles built before 9/09 or without option SA 662 built after 9/09


Unplug connector **X10372** from central bass, left (1) and connect to branch **A7**.


Connect branch **A8** to central bass (1).

Unplug connector **X10373** from central bass, left (1) and connect to branch **A5**.

Connect branch A6 to central bass (1).

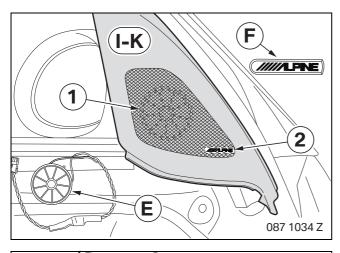

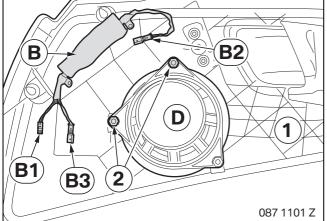

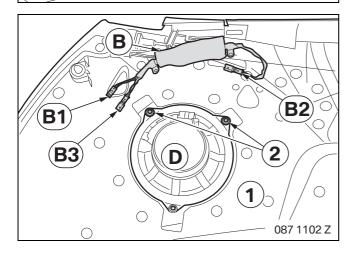

## All vehicles

If necessary, fit corner trim cover on mirror triangle I or cover on window frame K. ∢

Replace tweeter in mirror triangle (1) by tweeter **E** (see ISTA-RA 65 13 050.

Attach badge **F** to speaker grille (2) and adhere.

Follow the same procedure on the right-hand side.

# All E81, E82, E87, E88, E84 vehicles

Replace original speaker in door trim panel (1) by midrange speaker **D**, see ISTA-RA 65 13 070.

Secure diplexer **B** to mid-range speaker **D** with nuts (2).

Connect branch **B1** to mid-range speaker **D**.

Connect branch **B2** to tweeter **E**.

Connect branch  $\ensuremath{\textbf{B3}}$  to original socket housing for door speaker.

# All E90, E91, E92, E93 vehicles

Replace original speaker in door trim panel (1) by midrange speaker **D**, see ISTA-RA 65 13 070.


Secure diplexer **B** to mid-range speaker **D** with screws (2).


Connect branch **B1** to mid-range speaker **D**.

Connect branch **B2** to tweeter **E**.

Connect branch **B3** to original socket housing for door speaker.

#### Installing and connecting retrofit kit 6.

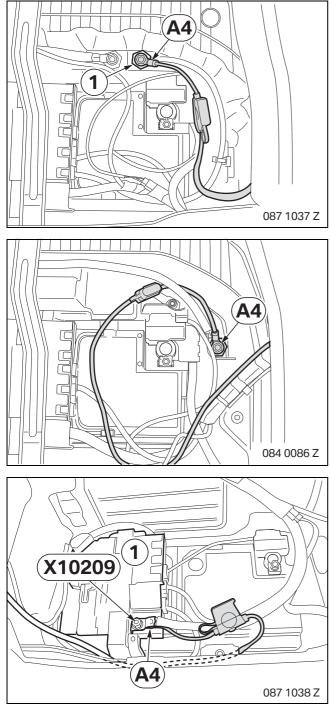

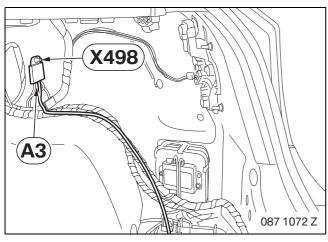

Only E81, E82, E87, E88 vehicles Screw down branch A4 at positive pin at battery terminal in luggage compartment well (1).

### **Only E84 vehicles**

Screw down branch A4 at positive pin at battery terminal in luggage compartment well (1).

# Only E90, E91, E92, E93 vehicles

Screw down branch A4 at terminal X10209 an rear fuse box (1).

# **All vehicles**

Screw down branch A3 at ground terminal X498 on right-hand wheel arch.

# 7. Finishing off and coding




Vehicles equipped with option SA 662 do not require encoding.

The retrofit system requires encoding.

- Reconnect vehicle battery
- Test vehicle using ISTA system and pay attention to fault codes entered in the memories and work through as required
- Go to ISTA/P vehicle programming
- Select "HiFi System Alpine" via the Conversion path and work through action plan
- Please refer to the information provided in the ISTA/P application documentation when working with ISTA/P
- Reassemble vehicle in reverse order of removal

#### **Customer information**

The "Customer Information on the HiFi System Alpine" at the end of the installation instructions should be printed out and handed over to the customer.

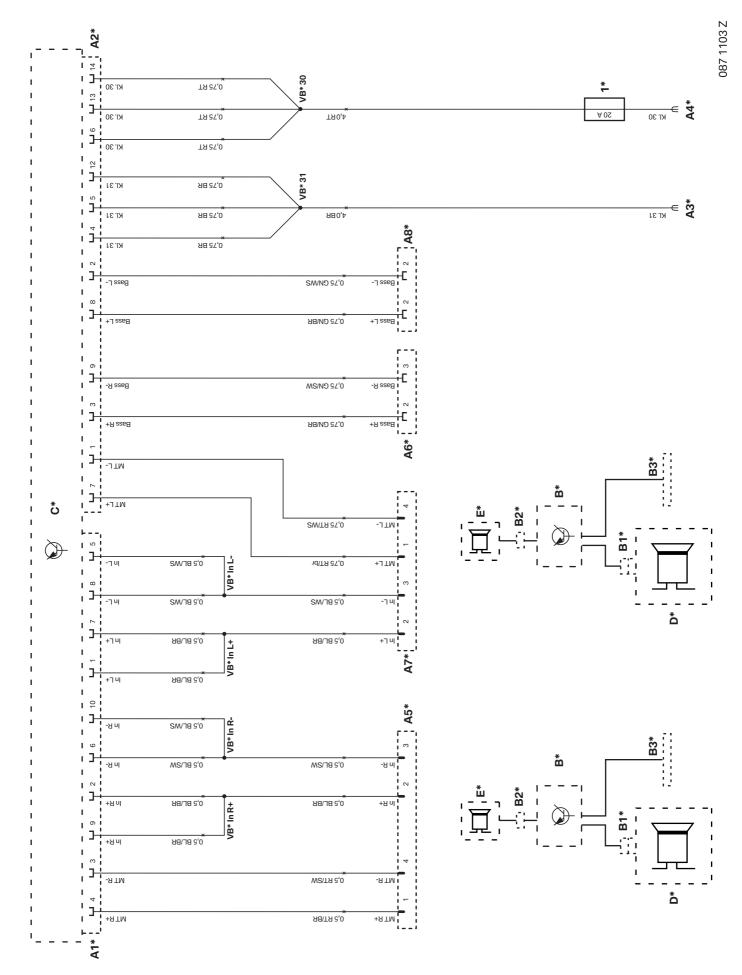

### Legend

- A1\* 10-pin WS pin housing
- A2\* 14-pin WS pin housing
- A3\* Eyelet M6, connection point terminal 31 at ground terminal point X498
- A4\* Eyelet M8, connection point terminal 30
- A5\* 4-pin SW pin housing, at vehicle-side connector **X10373** of central bass, right
- A6\* SW 4-pin socket housing at central bass, right
- A7\* 4-pin SW pin housing, at vehicle-side connector X10372 of central bass, left
- **A8\*** SW 4-pin socket housing at central bass, left
- B\* Diplexer
- B1\* At mid-range speaker D
- B2\* At tweeter E
- **B3\*** At original socket housing of speaker
- C\* Amplifier
- D\* Mid-range speaker
- E\* Tweeter
- 1\* Fuse holder (20 amp)


All designations marked \* only apply to these installation instructions or this circuit diagram.


### **Cable colours**

BL	Blue	RT	Red
BR	Brown	SW	Black
GN	Green	WS	White

# 9. Customer information on HiFi System Alpine

In the event of the system failing, check the power supply as follows:

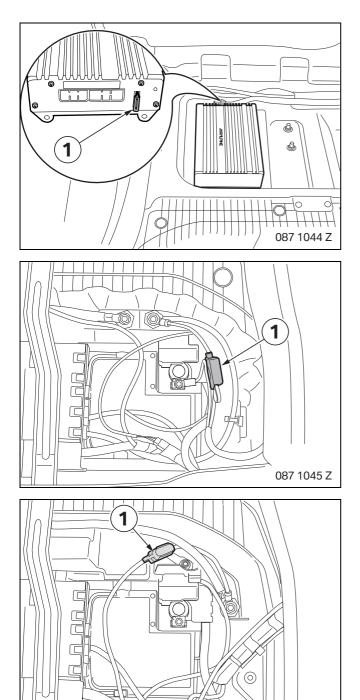

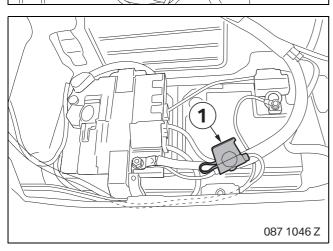

- Remove floor panel in luggage compartment
- Check fuse (1) at the amplifier
- If necessary, replace by a new 20 amp fuse

# Only on 1 Series vehicles

- Remove floor panel in luggage compartment
- Check fuse in fuse holder (1)
- If necessary, replace by a new 20 amp fuse

# Only on X1 vehicles

- Remove floor panel in luggage compartment
- Check fuse in fuse holder (1)
- If necessary, replace by a new 20 amp fuse

# Only on 3 Series vehicles

- Remove flap on right in luggage compartment trim panel
- Check fuse in fuse holder (1)
- If necessary, replace by a new 20 amp fuse

084 0088 Z